Release Note for Vigor2820 Series

Firmware Version: 3.3.0 Date: October 16, 2008

Applied Models: Vogor2820/Vigor2820n/Vigor2820Vn

- File and Modem Code
 - (1)For Annex A Model,
 - > "v2820_v0330_211011_A" is used for modem code 211011(Standard).
 - > "v2820 v0330 211801 A" is used for modem code 211801.
 - > "v2820_v0330_2121501_A" is used for modem code 2121501.
 - > "v2820 v0330 2211201 A" is used for modem code 2211201.

(2)For Annex B Model,

- > "v2820_v0330_2111112_B" is used for modem code 2111112. (Standard)
- ➤ "v2820_v0330_214702_B" is used for modem code 214702.
- ➤ "v2820_v0330_215202_B" is used for modem code 215202.
- ➤ "v2820 v0330 2121302 B" is used for modem code 2121302.
- ➤ "v2820_v0330_2111312_B" is used for modem code 2111312.
- > "v2820 v0330 2111302 B" is used for modem code 2111302.

New Features

- Support VPN IKE AES128/AES192/AES256 and MODP Group 14.
- Support windows vista L2TP IPSec.
- Support CSM (Content Security Management) and allow users to configure IM/P2P Filter Profile, URL Content Filter Profile and Web Content Filter Profile
- Support new functions of Firewall such as specifying IM/P2P Filter profile, URL Content Filter profile and Web Content Filter profile for filtering

Improvement

- Change the Wi-Fi SSID from "default" to "DrayTek".
- Improve system stability by adjusting the stack size.
- Improve the connection stability of 3G network
- Restore Specify Remote Node in VPN and Remote Access>>Remote Dial-In User page
- Corrected: VoIP call log cannot be displayed correctly by using telnet command.

- Corrected: Caller ID cannot be displayed on the phone which is using DTMF mode to display it.
- Corrected: Caller ID cannot be displayed normally for internal call.
- Corrected: Potential reboot will be happened due to the buffer size.
- Corrected: VoIP buffer leakage problem.
- Corrected: PPTP interface cannot work normally.
- Corrected: Modify IM/P2P signature for FeiDian Player.
- Corrected: Port redirection cannot work while using WAN IP alias.
- Corrected: Phone setting always uses the first SIP account as the default dial-out account
- Corrected: WAN IP cannot be reverted to factory default if **True IP** in **NAT>>DMZ Host Setup** is not enabled.
- Corrected: Web configuration is not compatible with Firefox 3 version.
- Corrected: The router will reboot due to VPN connection with fragmented packets.

Known Issue

• Vigor2820 series does not support VoIP T.38 fax relay function yet.

Notes

Modifications

None